After picking the point on the screen, a **glyph (arrow)** is shown in the drawing at the location for the new point.

(2-442) The **Command: line** prompts you to **Enter Point Desription <>:**. Type **PINE** and then press **Enter**.

Note: If you accidentally type in the wrong **Description**, continue on until we finish this **Draw-Locate Points** command. Then, double left-click on the point and change its **CRD File Description** and **Drawing File Description**.
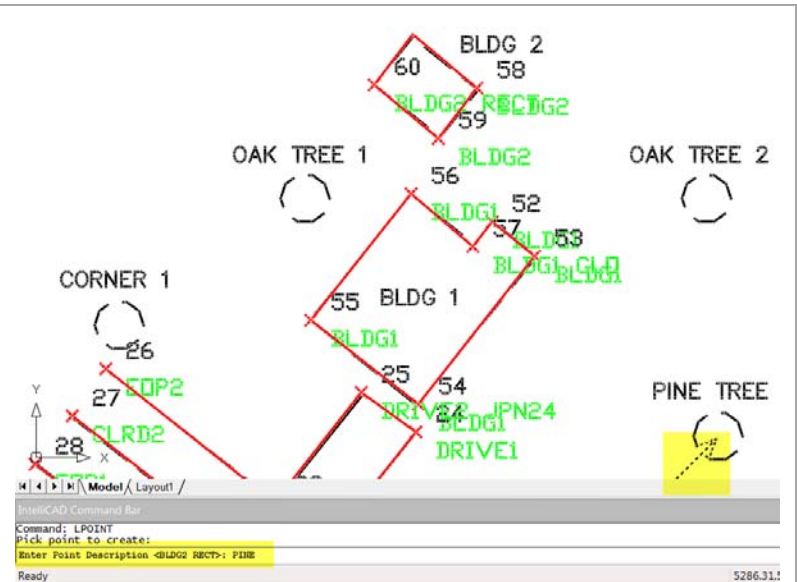
Point 61 is created in the drawing and the **Command: line** again prompts you to **Pick point to create:**.

(2-443) Press **Enter** to finish the command and return to the **Command: prompt**.
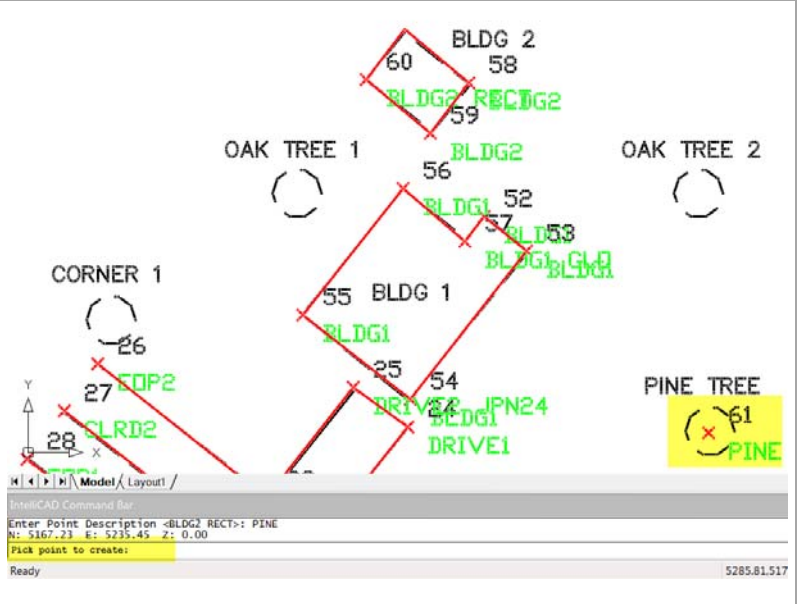
Unlike the points we've collected so far, the **Symbols** and **Descriptions** for the points we collect for trees and property corners will remain visible and be used to label the features in our final, plotted drawing.

This changes things in two ways: 1) we will need to make sure that the **Symbols** for trees and property corners are visible even when the points and attributes are frozen and 2) we will want to show a **Full Description** for these points rather than the **Raw Description**.

Let's start by **Drawing Field to Finish** to see how the *PINE TREE* layers and **Description** work now.

(2-444) Go to the **Survey Menu** and pick **Draw Field to Finish**.
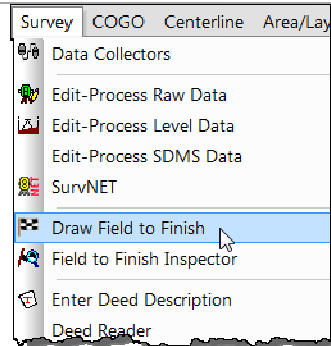
(2-445) Pick the option to **Split all multiple codes** and then pick the **OK** button.
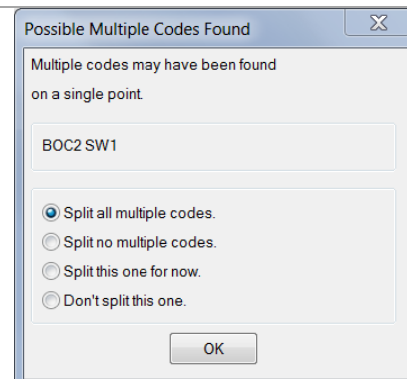
(2-446) In the **Draw Field to Finish** box, pick the **All** button to set the **Range of Points** to **ALL**.

(2-447) Make sure all other settings match those shown on the right and then pick the **OK** button.
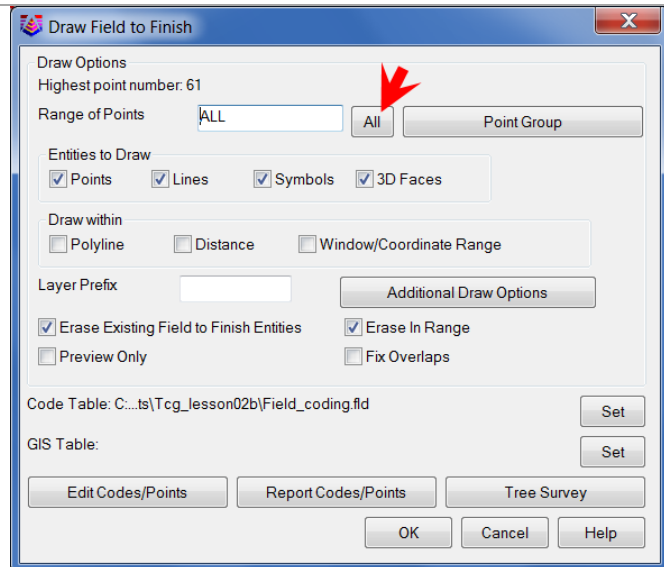
After drawing with **Field to Finish**, you can see that *Point 61* now has a different **Symbol** and no displayed **Description**.

(2-448) Double left-click on any part of *Point 61* to open the **Edit Point** window.

---

www.thatcadgirl.com   *(919) 417-8351*

In the **Edit Point** window you can see the **Symbol Name** is *TREE2* and, while we have a **CRD File Description**, there is no **Drawing Description**.

These parameters are set based on the *PINE* **Field Code** in the **Field Code Table** so we'll take another look at the **Field Code** definition.

(2-449) Pick the **OK** button to close.

Edit Point

Symbol Name TREE2

Select Symbol

History

Point Number   61
North (Y)   5167.2260480
East (X)   5235.4484950
Elevation (Z)   0.0000000
Elevation Decimals   No Label
Drawing Description
CRD File Description   PINE
Notes

OK   Cancel   Help

(2-450) Go to the **Survey Menu** and pick **Draw Field to Finish**.

Survey   COGO   Centerline   Area/Lay

Data Collectors

Edit-Process Raw Data

Edit-Process Level Data

Edit-Process SDMS Data

SurvNET

Draw Field to Finish

Field to Finish Inspector

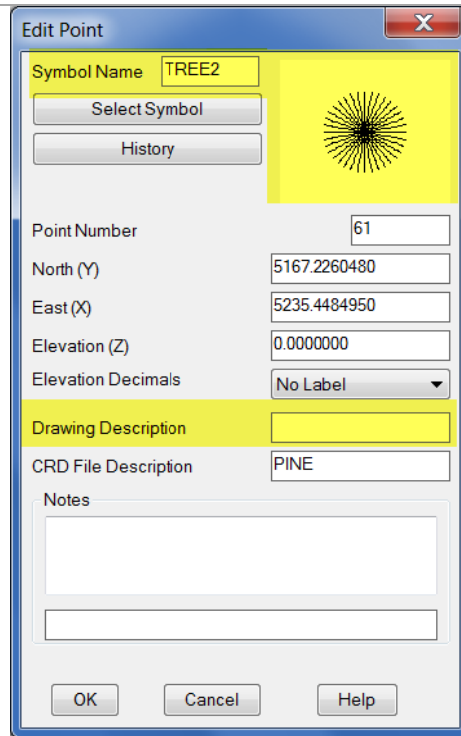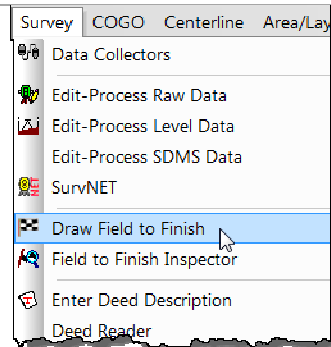Enter Deed Description

Deed Reader

---

www.thatcadgirl.com   (919) 417-8351
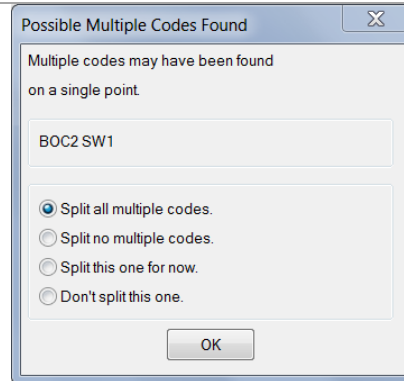
(2-451) Pick the option to **Split all multiple codes** and then pick the **OK** button.	**Possible Multiple Codes Found** Multiple codes may have been found on a single point. BOC2 SW1 ⦿ Split all multiple codes. ○ Split no multiple codes. ○ Split this one for now. ○ Don't split this one. [OK]
(2-452) In the **Draw Field to Finish** box, pick the **Edit Codes/Points** button.	**Draw Field to Finish** Draw Options Highest point number: 61 Range of Points [ALL] [All] [Point Group] Entities to Draw ☑ Points ☑ Lines ☑ Symbols ☑ 3D Faces Draw within ☐ Polyline ☐ Distance ☐ Window/Coordinate Range Layer Prefix [ ] [Additional Draw Options] ☑ Erase Existing Field to Finish Entities ☑ Erase In Range ☐ Preview Only ☐ Fix Overlaps Code Table: C:...ts\Tcg_lesson02b\Field_coding.fld [Set] GIS Table: [Set] [Edit Codes/Points] [Report Codes/Points] [Tree Survey] [OK] [Cancel] [Help]